



SPECIFICATIONS

Item No.: LCA318T

Description: Current Type Single-axis Inclinator

Production implementation standard reference

- Enterprise quality system standards: ISO9001: 2008 standard (certification number: 128101)
- Tilt sensor production standards: GB / T 191 SJ 20873-2003 inclinometer general specification of Level
- The Academy of metrology and quality inspection Calibrated in accordance to: JJF1119-2004
Electronic Level calibration Specification
- Gyro accelerometer test standard: QJ 2318-92 Gyro accelerometer test methods
- Software development reference standard: GJB 2786A-2009 military software development General requirements
- Product environmental testing standards: GJB150
- Electromagnetic anti-interference test standards: GB / T 17626
- Ver.:06
- Date:2014.8.1

LCA318T- Current Type Single-axis Inclinometer



General Description

The LCA318T series inclinometer, developed by Rion for the market with special requirement on volume and cost, is a small volume MEMS single-axis tilt sensor. Output current goes through an internal secondary linearity correction, it is a linearity current output tilt sensor. Due to built-in the latest MEMS production technology inclination unit, it achieve small size, long distance transmission can up to over 2000 Meters, strong ability of resisting external electromagnet interference, capable of long-term working in the industry harsh environment.

This product adopts the non-contact measuring principle, can output real-time current attitude angle, simple to use, no need to find the relative variation of the two surface for mounting. It is a ideal choice for Industrial automation control and platform measuring attitude !

Features

- Single-Axis Inclinometer
- Accuracy: refer to the technical data
- Output mode: 4~20mA
- IP67 protection class
- Resolution: 0.1°
- Full measuring range anyone within 360° optional
- Wide voltage input: 9~36V
- Wide temperature working: -40~+85℃
- Highly anti-vibration performance >3500g
- Small Volume : 55×37×24mm (customized)

Application:

- Electric blind man chair leveling
- Satellite antenna positioning
- Car Chassis Measurement
- engineering mechanical measurement of dip angle
- Cloud deck operating monitor
- Medical equipment leveling
- Four - wheeled positioning system



LCA318T- Current Type Single-axis Inclinometer

Technical Data

Parameters	Conditions	LCA318T-30	LCA318T-60	LCA318T-90	LCA318T-360	Unit
Measuring range		±30	±60	±90	±180	°
Measuring axis		X	X	X	X	
ZERO output	0° output	12	12	12	12	MA
Resolution		0.1	0.1	0.1	0.1	°
Absolute accuracy		0.1	0.2	0.3	0.4	°
Long term stability		<0.5	<0.5	<0.5	<0.5	
Zero temperature coefficient	-40~85°	±0.008	±0.008	±0.008	±0.008	°/°C
Sensitivity temperature coefficient	-40~85°	≤150	≤150	≤150	≤150	ppm/°C
Power on time		0.5	0.5	0.5	0.5	S
Response time		0.05	0.05	0.05	0.05	s
Response		1~20	1~20	1~20	1~20	Hz
EMC	According to EN61000 and GBT17626					
MTBF	≥45000 hours/times					
Insulation Resistance	≥100M					
Shockproof	100g@11ms、3Times/Axis(half sinusoid))					
Anti-vibration	10grms、10~1000Hz					
Protection glass	IP67					
Cables	Standard 1M length、wearproof、grease proofing、wide temperature、Shielded cables4*0.4mm2					
Weight	90g(without cable)					

*This Technical data only list ± 30 °, ± 60 °, ± 90 °, ± 360 ° series for reference, other measuring range please refer to the adjacent parameters.

Electronic Characteristics

Parameters	Conditions	Min	Standard	Max	Unit
Power supply	Standard	9	12、24	36	V
	Optional		5		V
Working current			50		mA
Output overload	Resistive	400		1000	kΩ
Working temperature		-40		+85	°C
Store temperature		-55		+125	°C

LCA318T- Current Type Single-axis Inclinometer

Key words:


Resolution: Refers to the sensor in measuring range to detect and identify the smallest changed value.

Absolute accuracy: Refers to in the normal temperature circumstances, the sensor absolute linearity, repeatability, hysteresis, zero deviation, and transverse error comprehensive error.

Long term stability: Refers to the sensors in normal temperature conditions, the deviation between the maximum and minimum values after a year's long time work.

Response time: Refers to the sensor in an angle change, the sensor output value reached the standard time required.

Ordering information:

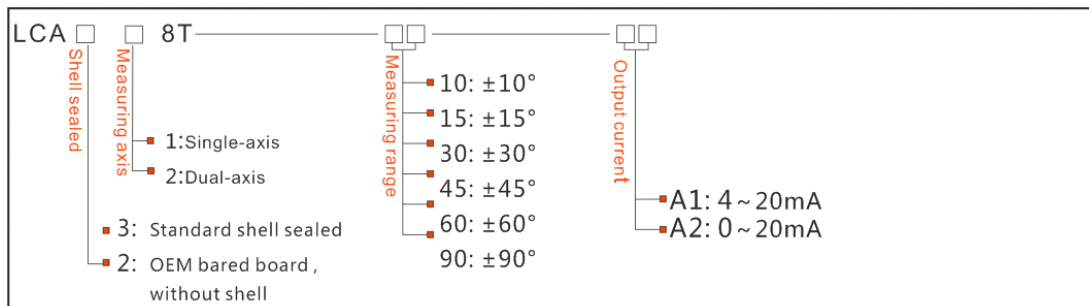


E.g: LCA318T-10-A1: Single-axis/Standard/ $\pm 10^\circ$ Measuring range/4-20mA output current

Mechanical Parameters

- Connectors: 1m lead cable (customized)
- Protection glass: IP67
- Enclosure material: Aluminum Oxide
- Installation: 3*M4 screws

Working Principle

Adopt the European import of core control unit, using the capacitive micro pendulum principle and the earth gravity principle, when the the inclination unit is tilted, the Earth's gravity on the corresponding pendulum will produce a component of gravity, corresponding to the electric capacity will change, , by enlarge the amount of electric capacity, filtering and after conversion then get the inclination.

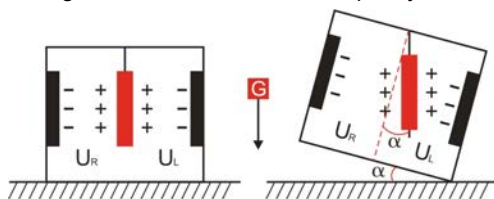


U_R, U_L Respectively is the pendulum left plate and the right plate corresponding to their respective voltage between the electrodes, when the tilt sensor is tilted, U_R, U_L will change according to certain rules, so $f(U_R, U_L)$ On the inclination of α function:

$$\alpha = f(U_R, U_L)$$

Measuring Directions&Fix

The installation must guarantee the product bottom is parallel to measured face, and reduce the influence of dynamic and acceleration to the sensor. This product can be installed horizontally or mounted vertically (mounted vertically selection is only applicable to the single axis), for installation please refer to the following scheme.

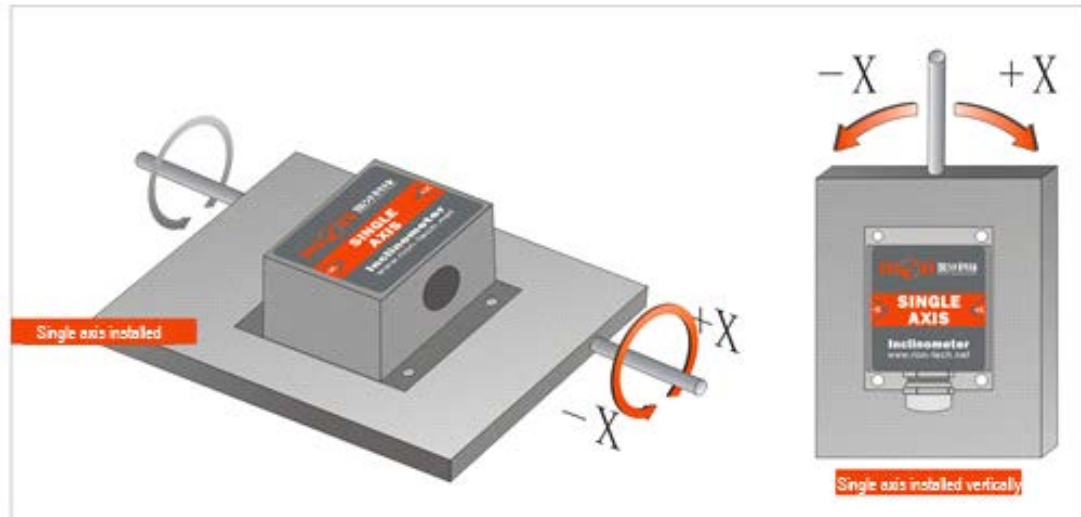

Angle output calculation formula

Angle=(Output current—Zero position current)÷Angle sensitivity

Angle sensitivity=output current range÷ Angle measuring range


E.g: LCA318T-30-A1 (±30° Measuring range 16mA output current range)

Angle sensitivity= 16÷60=0.266666 mV/°

Production installation notes:


Please follow the correct way to install tilt sensor, incorrect installation can cause measurement errors, with particular attention to the "surface", "line"::

- 1) The Sensor mounting surface and the measured surface must be fixed closely, smoothly, stability, if mounting surface uneven likely to cause the sensor to measure the angle error. See Figure Pic.AB
- 2) The sensor axis and the measured axis must be parallel, the two axes do not produce the angle as much as possible. See Figure Pic.CD

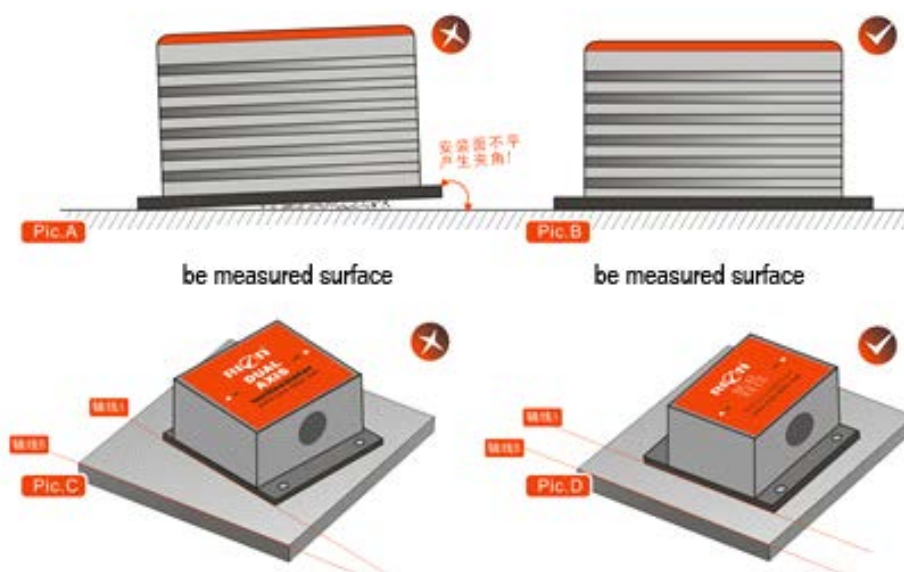

LCA318T- Current Type Single-axis Inclinator

Dimension

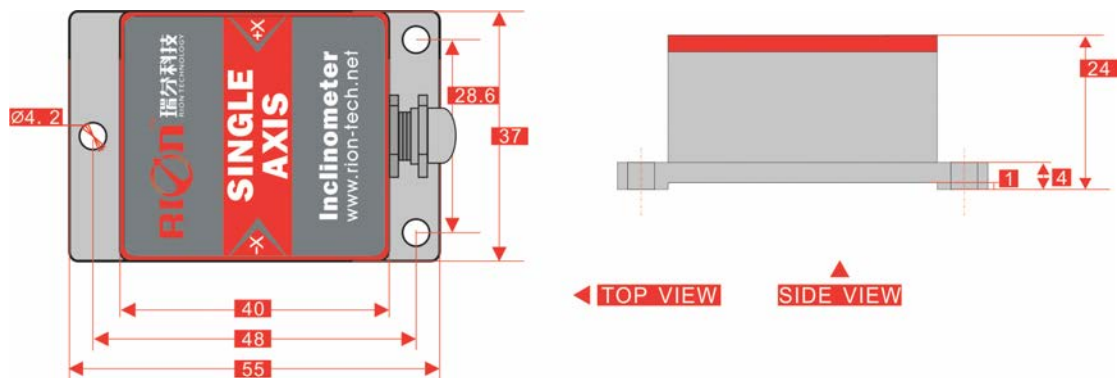

Size: L55mm×W37mm×H24mm

Electrical Connection

Line color	BLACK	YELLOW	RED	GREEN
function	GND Power Negative	Out X- Output current	DC 9-36V	NC



※More products information, please refer to the company's Website : www.rion-tech.net



深圳市瑞芬科技有限公司
CHINA SHENZHEN RION TECHNOLOGY CO., LTD.

✓ 倾角传感器 ✓ 倾角（调平）开关 ✓ 数显水平仪 ✓ 陀螺仪
✓ 三维电子罗盘 ✓ 加速度计 ✓ 航姿参考系统 ✓ 寻北仪

T: 0755-29657137 / 29761269 F: 0755-29123494
W: www.rion-tech.net E: sales@rion-tech.net
A: 中国·深圳市宝安区82区华丰科技园五期3F

Arcuate Solution Provider
弧高方案解决专家！